

Work Order ID 89858***89858***

Page 1

Tuesday, September 11, 2012 3:46:14 PM

Item ID: D212-664-107TRN

Accept

N900040100

Setup

Start

NS1

Revision ID:

Item Name: Crosstube Turning Detail

Stop

NS2

Start Date: 9/11/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/17/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan:

Date: 12-9-11

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr								
----------	--------------	--	--	--	--	--	--	--	--

D212-664-147

Rev B(DE0)

100

100

MORI SEIKI CNC LATHE LARGE

Mori Seiki

Memo

Mori Seiki CNC Lathe Large

0.00

0.00

1-Fill tube with sand & install plugs DT8534 on both ends as per Folio FA705

2-Turn first side as per Folio FA113

3-Blend transition lines only, **do not sand whole tube**:

FOLIO REV: ADWG REV: B

*Use mill bastard file, brush file repeatedly with file card.

*Do not use sandpaper coarser than 320 grit.

110

QC1- Inspect dimensions to dimension sheet

0.00

110

QC

Memo

0.00

Quality Control

1 / ✓ KC 12-9-161 / ✓ KC 12-9-16

NCR: Yes / No

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS									
Part No. _____		Rework <input type="checkbox"/>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>							
NCR No. _____		Scrap <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coor. <input type="checkbox"/>	Quality <input type="checkbox"/>							
		Use-as-is <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>							
		Work Order Update <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>								
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector				
Doc/Data													
Equip/Tooling													
Operator													
Material													
Setup													
Other													
Process													
Supplier													
Training													
Unapproved													
FAULT CATEGORY													
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube				General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio				<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions		<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled	
												<input type="checkbox"/> Other	

Work Order ID 89858

Tuesday, September 11, 2012 3:46:14 PM

89858

Page 2

Item ID: D212-664-107TRN

Accept

N900040100

Setup

Start

NS1

Revision ID:

Item Name: Crosstube Turning Detail

Stop

NS2

Start Date: 9/11/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/17/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan:

Date:

Tooling:

Date:

Run

Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120 *120* Mori Seiki	MORI SEIKI CNC LATHE LARGE	0.00							<i>1</i> <i>f</i> <i>KC</i> <i>12-9-16</i>
Mori Seiki CNC Lathe Large	Memo	0.00							
	1-Turn second side as per Folio FA705								
	2-Blend transition lines only, **do not sand whole tube**: *Use mill bastard file, brush file repeatedly with file card. *Do not use sandpaper coarser than 320 grit.								
	FOLIO REV: <i>A</i> DWG REV: <i>B</i>								
	3- Remove plugs and sand								
130 *130* QC	QC1- Inspect dimensions to dimension sheet	0.00							<i>1</i> <i>f</i> <i>KC</i> <i>12-9-16</i>
Quality Control	Memo	0.00							

NCR: Yes / No

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION		AGAINST DEPARTMENT/PROCESS					
				Rework Scrap Use-as-is Work Order Update	Skid-tube Machining Thermoforming Large Fab	Crosstube Small Fab Finishing Composite	Water Jet Prod. Eng. Coor. Rec/Store/Packaging Supplier	Engineering Quality Other			
Root Cause		Date	Step	Qty	Description of work order update or Non-conformance		Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											
FAULT CATEGORY											
Landing Gear Bending Centre Not Concentric to O/S Cracks Crushed/Crimped. Cuffs Heat Treat Inspection Strip in Tube Ripples in Bend Torque Waves in Extrusion Turning Sequence Wave/Twist in Tube					General Bend BOM/Route Broken/Damaged Burrs Contamination Countersink Cut Too Short Drill Holes Drawing Finish Folio Grain Hardware Inspection Incomplete Instructions Incomplete/Unclear Maintenance Mislabeled Misread Offset Out of Calibration Out of Sequence Outside Dimensions						

NCR: Yes / No

DQA: Date:

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order: _____ Part No. _____ NCR No. _____				DISPOSITION		AGAINST DEPARTMENT/PROCESS					
				Rework Scrap Use-as-is Work Order Update	Skid-tube Machining Thermoforming Large Fab	Crosstube Small Fab Finishing Composite	Water Jet Prod. Eng. Coor. Rec/Store/Packaging Supplier	Engineering Quality Other			
Root Cause		Date	Step	Qty	Description of work order update or Non-conformance		Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											
FAULT CATEGORY											
Landing Gear Bending Centre Not Concentric to O/S Cracks Crushed/Crimped. Cuffs Heat Treat Inspection Strip in Tube Ripples in Bend Torque Waves in Extrusion Turning Sequence Wave/Twist in Tube				General Bend BOM/Route Broken/Damaged Burrs Contamination Countersink Cut Too Short Drill Holes Drawing Finish Folio		Grain Hardware Inspection Incomplete Instructions Incomplete/Unclear Maintenance Mislabeled Misread Offset Out of Calibration Out of Sequence Outside Dimensions		Ovalized Over/Under tolerance Part Incorrect Part Lost/Missing Part Moved Positioned Wrong Power Loss/Surge		Pressure/Forced Temperature/Cure Weld Wrong Stock Pulled Other	

Work Order ID 89858

Tuesday, September 11, 2012 3:46:14 PM

89858

Page 4

Item ID: D212-664-107TRN

Accept

N900040100

Setup

Start

NS1

Revision ID:

Item Name: Crosstube Turning Detail

Stop

NS2

Start Date: 9/11/2012 Start Qty: 1.00

1

Cust Item ID:

Required Date: 9/17/2012 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:	Process Plan:	Date:	Tooling:	Date:	Run	Start	*NR1*
	QC:	Date:	SPC (Y/N):	Date:	Stop		*NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
160 *160* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00			D4S 03 89				12-9-20
170 *170* Packaging Packaging	Packaging Memo Identify and stock in kanban rack Location: LC	0.00							12-9-20
180 *180* QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00							12/9/20 JJ MM 12-09-20

NCR: Yes / No

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS							
Part No. _____		Rework <input type="checkbox"/>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>					
NCR No. _____		Scrap <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coor. <input type="checkbox"/>	Quality <input type="checkbox"/>					
		Use-as-is <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>					
		Work Order Update <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>						
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector		
Doc/Data											
Equip/Tooling											
Operator											
Material											
Setup											
Other											
Process											
Supplier											
Training											
Unapproved											
FAULT CATEGORY											
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube				General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio <input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions				<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled	
										<input type="checkbox"/> Other	

Picklist Print

Page 1

Tuesday, September 11, 2012 3:46:18 PM

Work Order ID: 89858

89858

Parent Item: D212-664-107TRN

D212-664-107TRN

Parent Item Name: Crosstube Turning Detail

Start Date: 9/11/2012

Required Date: 9/17/2012

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:A New Issue 08-03-06 DD Verified by:ec
 IPP Rev B Removed polish 08.04.02 EC verified: DD

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D6019-128		Manufactured	No			110	Each	46.0000	1	1			**

D6019-128

Crosstube Material

Location	Loc Qty	Loc Code
LG	46	
69803	17	
75635	24	
79741	5	

marc 12/09/14

NCR: Yes / No

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order: _____			DISPOSITION			AGAINST DEPARTMENT/PROCESS									
			Rework <input type="checkbox"/>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>		Engineering <input type="checkbox"/>							
			Scrap <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coor. <input type="checkbox"/>		Quality <input type="checkbox"/>							
			Use-as-is <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>		Other <input type="checkbox"/>							
			Work Order Update <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance		Initial Chief Eng	Action Description		Sign & Date	Verification	QC Inspector				
Doc/Data															
Equip/Tooling															
Operator															
Material															
Setup															
Other															
Process															
Supplier															
Training															
Unapproved															
FAULT CATEGORY															
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube				General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio				<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions				<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled	
														<input type="checkbox"/> Other	

DART AEROSPACE LTD	Work Order:	09858
Description: Crosstube Assembly (205/212/412 Low Fwd)	Part Number:	D212-664-147
Inspection Dwg: D212-664-147 Rev: B		Page 1 of 2

FIRST ARTICLE INSPECTION CHECKLIST

Inspection Sheet Drawing Dimension	Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	0.313	+/-0.010	3.18	/	U.S.	1005928
	2.360	+0.005/-0.000	2.365	/	VERN	CNC -08
	2.360	+0.005/-0.000	2.365	/		
	2.366	+0.005/-0.000	2.470	/		
	2.473	+0.005/-0.000	2.478	/		
	2.573	+0.005/-0.000	2.576	/		
	2.673	+0.005/-0.000	2.678	/		
	2.750	+0.005/-0.000	2.750	/		
	2.750	+0.005/-0.000	2.750	/		
SIDE B	0.313	+/-0.010	3.18	/	U.S.	1005928
	2.360	+0.005/-0.000	2.365	/	VERN	1005928 CNC -08
	2.360	+0.005/-0.000	2.365	/		
	2.366	+0.005/-0.000	2.371	/		
	2.473	+0.005/-0.000	2.479	/		
	2.573	+0.005/-0.000	2.576	/		
	2.673	+0.005/-0.000	2.678	/		
	2.750	+0.005/-0.000	2.750	/		
	2.750	+0.005/-0.000	2.750	/		
	0.126.528	+/-0.020	126.528	✓	tape	LG-22

NCR: Yes / No

WORK ORDER NON-CONFORMANCE / UPDATE


DQA: _____ Date: _____

QA Closed: _____ Date: _____

Work Order: _____			DISPOSITION		AGAINST DEPARTMENT/PROCESS										
			Rework <input type="checkbox"/>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>								
			Scrap <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coor. <input type="checkbox"/>	Quality <input type="checkbox"/>								
			Use-as-is <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>								
			Work Order Update <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>									
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance		Initial Chief Eng	Action Description		Sign & Date	Verification	QC Inspector				
Doc/Data															
Equip/Tooling															
Operator															
Material															
Setup															
Other															
Process															
Supplier															
Training															
Unapproved															
FAULT CATEGORY															
Landing Gear <input type="checkbox"/> Bending <input type="checkbox"/> Centre Not Concentric to O/S <input type="checkbox"/> Cracks <input type="checkbox"/> Crushed/Crimped. <input type="checkbox"/> Cuffs <input type="checkbox"/> Heat Treat <input type="checkbox"/> Inspection Strip in Tube <input type="checkbox"/> Ripples in Bend <input type="checkbox"/> Torque Waves in Extrusion <input type="checkbox"/> Turning Sequence <input type="checkbox"/> Wave/Twist in Tube				General <input type="checkbox"/> Bend <input type="checkbox"/> BOM/Route <input type="checkbox"/> Broken/Damaged <input type="checkbox"/> Burrs <input type="checkbox"/> Contamination <input type="checkbox"/> Countersink <input type="checkbox"/> Cut Too Short <input type="checkbox"/> Drill Holes <input type="checkbox"/> Drawing <input type="checkbox"/> Finish <input type="checkbox"/> Folio				<input type="checkbox"/> Grain <input type="checkbox"/> Hardware <input type="checkbox"/> Inspection Incomplete <input type="checkbox"/> Instructions Incomplete/Unclear <input type="checkbox"/> Maintenance <input type="checkbox"/> Mislabeled <input type="checkbox"/> Misread <input type="checkbox"/> Offset <input type="checkbox"/> Out of Calibration <input type="checkbox"/> Out of Sequence <input type="checkbox"/> Outside Dimensions				<input type="checkbox"/> Ovalized <input type="checkbox"/> Over/Under tolerance <input type="checkbox"/> Part Incorrect <input type="checkbox"/> Part Lost/Missing <input type="checkbox"/> Part Moved <input type="checkbox"/> Positioned Wrong <input type="checkbox"/> Power Loss/Surge		<input type="checkbox"/> Pressure/Forced <input type="checkbox"/> Temperature/Cure <input type="checkbox"/> Weld <input type="checkbox"/> Wrong Stock Pulled	
												<input type="checkbox"/> Other			

DART AEROSPACE LTD	Work Order:	89838
Description: Crosstube Assembly (205/212/412 Low Fwd)	Part Number:	D212-664-147
Inspection Dwg: D212-664-147 Rev: B		Page 2 of 2

WALL THICKNESS MEASUREMENT

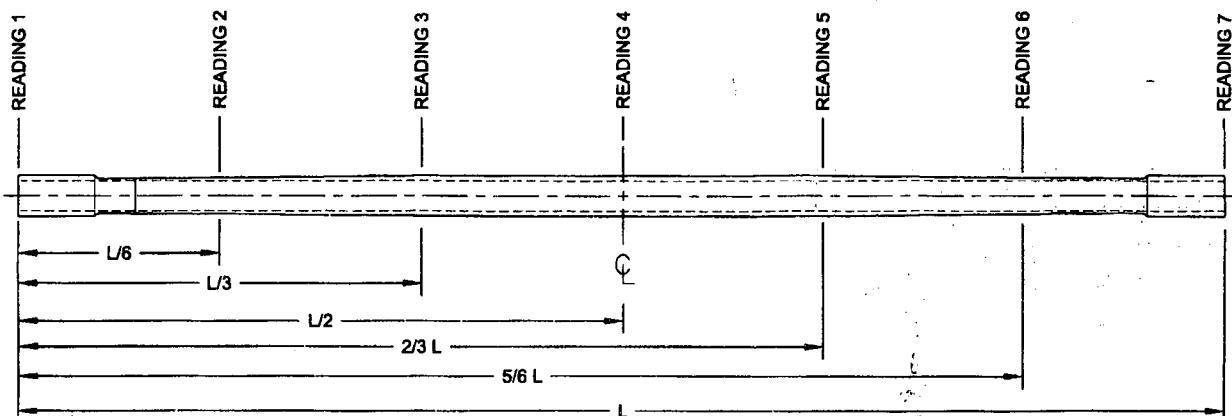

Location	WALL THICKNESS MEASUREMENT (IN)				Deviation Δw (max-min)	TOLERANCE
	w1	w2	w3	w4		
READING 1 L= 0"	.123	.121	.119	.128	.009	
READING 2 L=	.162	.145	.157	.179	.034	
READING 3 L=	.311	.310	.308	.312	.004	
READING 4 L=	.318	.316	.315	.316	.003	0.048"
READING 5 L=	.304	.309	.302	.316	.014	
READING 6 L=	.173	.160	.140	.171	.033	
READING 7 L=	.115	.128	.114	.125	.014	

Calibration Result

Actual Block Thickness: 100-500

Sitescan 250 Measured Thickness: 100-500

Measured by:	<i>KC</i>	Audited by:	<i>JW</i>	Prototype Approval:	N/A
Date:	12-9-16	Date:	12-9-17	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	08.11.07	New Issue (P/O D212-664-107)	KJ/EC	
B	10.02.02	Dimension 126.528 was 126.53	KJ	
C	12.06.04	Wall thickness form added	KJ	<i>JK</i> <i>JK</i>

NCR: Yes / No

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order: _____		DISPOSITION		AGAINST DEPARTMENT/PROCESS					
Part No. _____		Rework <input type="checkbox"/>	Skid-tube <input type="checkbox"/>	Crosstube <input type="checkbox"/>	Water Jet <input type="checkbox"/>	Engineering <input type="checkbox"/>			
NCR No. _____		Scrap <input type="checkbox"/>	Machining <input type="checkbox"/>	Small Fab <input type="checkbox"/>	Prod. Eng. Coor. <input type="checkbox"/>	Quality <input type="checkbox"/>			
		Use-as-is <input type="checkbox"/>	Thermoforming <input type="checkbox"/>	Finishing <input type="checkbox"/>	Rec/Store/Packaging <input type="checkbox"/>	Other <input type="checkbox"/>			
		Work Order Update <input type="checkbox"/>	Large Fab <input type="checkbox"/>	Composite <input type="checkbox"/>	Supplier <input type="checkbox"/>				
Root Cause	Date	Step	Qty	Description of work order update or Non-conformance	Initial Chief Eng	Action Description	Sign & Date	Verification	QC Inspector
Doc/Data									
Equip/Tooling									
Operator									
Material									
Setup									
Other									
Process									
Supplier									
Training									
Unapproved									
FAULT CATEGORY									
Landing Gear	General								
	Bending <input type="checkbox"/>	Bend <input type="checkbox"/>	Grain <input type="checkbox"/>	Ovalized <input type="checkbox"/>	Pressure/Forced <input type="checkbox"/>				
	Centre Not Concentric to O/S <input type="checkbox"/>	BOM/Route <input type="checkbox"/>	Hardware <input type="checkbox"/>	Over/Under tolerance <input type="checkbox"/>	Temperature/Cure <input type="checkbox"/>				
	Cracks <input type="checkbox"/>	Broken/Damaged <input type="checkbox"/>	Inspection Incomplete <input type="checkbox"/>	Part Incorrect <input type="checkbox"/>	Weld <input type="checkbox"/>				
	Crushed/Crimped. <input type="checkbox"/>	Burrs <input type="checkbox"/>	Instructions Incomplete/Unclear <input type="checkbox"/>	Part Lost/Missing <input type="checkbox"/>	Wrong Stock Pulled <input type="checkbox"/>				
	Cuffs <input type="checkbox"/>	Contamination <input type="checkbox"/>	Maintenance <input type="checkbox"/>	Part Moved <input type="checkbox"/>					
	Heat Treat <input type="checkbox"/>	Countersink <input type="checkbox"/>	Mislabeled <input type="checkbox"/>	Positioned Wrong <input type="checkbox"/>					
	Inspection Strip in Tube <input type="checkbox"/>	Cut Too Short <input type="checkbox"/>	Misread <input type="checkbox"/>	Power Loss/Surge <input type="checkbox"/>					
	Ripples in Bend <input type="checkbox"/>	Drill Holes <input type="checkbox"/>	Offset <input type="checkbox"/>		Other <input type="checkbox"/>				
	Torque Waves in Extrusion <input type="checkbox"/>	Drawing <input type="checkbox"/>	Out of Calibration <input type="checkbox"/>						
	Turning Sequence <input type="checkbox"/>	Finish <input type="checkbox"/>	Out of Sequence <input type="checkbox"/>						
	Wave/Twist in Tube <input type="checkbox"/>	Folio <input type="checkbox"/>	Outside Dimensions <input type="checkbox"/>						

B

Item	Qty -147	Qty -147B	Part Number	Description
1	X		D212-664-147	CROSSTUBE ASSEMBLY (205/212/412 LOW FWD)
2		X	D212-664-147B	CROSSTUBE ASSEMBLY (214 LOW FWD)
3	1	1	D6019-128	CROSSTUBE
4	2	2	D2893-1	SUPPORT
5	4	4	D3595-063-450	RUBBER CUSHION
6	2	2	D3659-1	CUFF
7	4	4	MS21920-25	CLAMP (OR MS21920-26)
8	44	44	CR3212-4-06	RIVET (OR M78853-4-06)
9	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
10	A/R	A/R	SIKAFLEX-241/-291	SEALANT (OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURED FROM D6019-128
FINISHED LENGTH = 126.528±0.020 (BEFORE BENDING/TRIMMING)
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUDD USING VIBRATING STYLUS.
- 7) WEIGHT: D212-664-147 = 24.2 lbs (PER IIN-D212-664)
D212-664-147B = 24.2 lbs (PER IIN-D212-664)
- 8) PART IS SYMMETRIC ABOUT CENTERLINE.
- 9) WHEN MACHINING TAPER, RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 10) BEND PROGRESSIVELY WITH A MINIMUM OF 8 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D. EXCEPT UP TO 10% IS ALLOWED IN AREA NOTED.
- 11) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.
- 13) INSTALL MS21920-25 CLAMPS (OR -26) WITH D3595-063-450 RUBBER CUSHIONS TO SECURE THE D2893-1 SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE OF CROSSTUBE SUPPORT.
- 14) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.
- 16) INSTALL D3659-1 CUDD AFTER CHEMICAL CONVERSION COAT BUT BEFORE PAINT, WITH A LAYER OF SIKAFLEX-241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT BETWEEN CUDD AND CROSSTUBE. SEAL EDGE OF CUDD TO ENSURE NO GAPS.
- 17) TOUCH-UP HOLES WITH CHEMICAL CONVERSION COAT.


8/28/05 8
11/10/09 11


DEO ATTACHED

per ECN #11-64
11/07/09
UNDER REVIEW
11/10/09

RELEASED
2009-10-29
JW

B	REVISE GENERAL NOTES/PART LIST; UPDATE TO CURRENT STANDARDS; ADD -147B (ZN C4-2, D4-2)	RF	09.09.30
A	NEW ISSUE	CP	07.07.07
REV.	DESCRIPTION	BY	DATE
DESIGN	90	DART AEROSPACE LTD	
DRAWN	RF	HAWKESBURY, ONTARIO, CANADA	
CHECKED	90	DRAWING NO.	REV. B
MFG. APPR.	DS	D212-664-147	SHEET 1 OF 4
APPROVED	NO	TITLE	SCALE
DE APPR.	NO	CROSSTUBE (205/212/412 LOW FWD) NTS	
DATE	09.09.30	COPYRIGHT © 2007 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OTHER THAN THAT FOR WHICH IT WAS ISSUED, OR DISCLOSED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

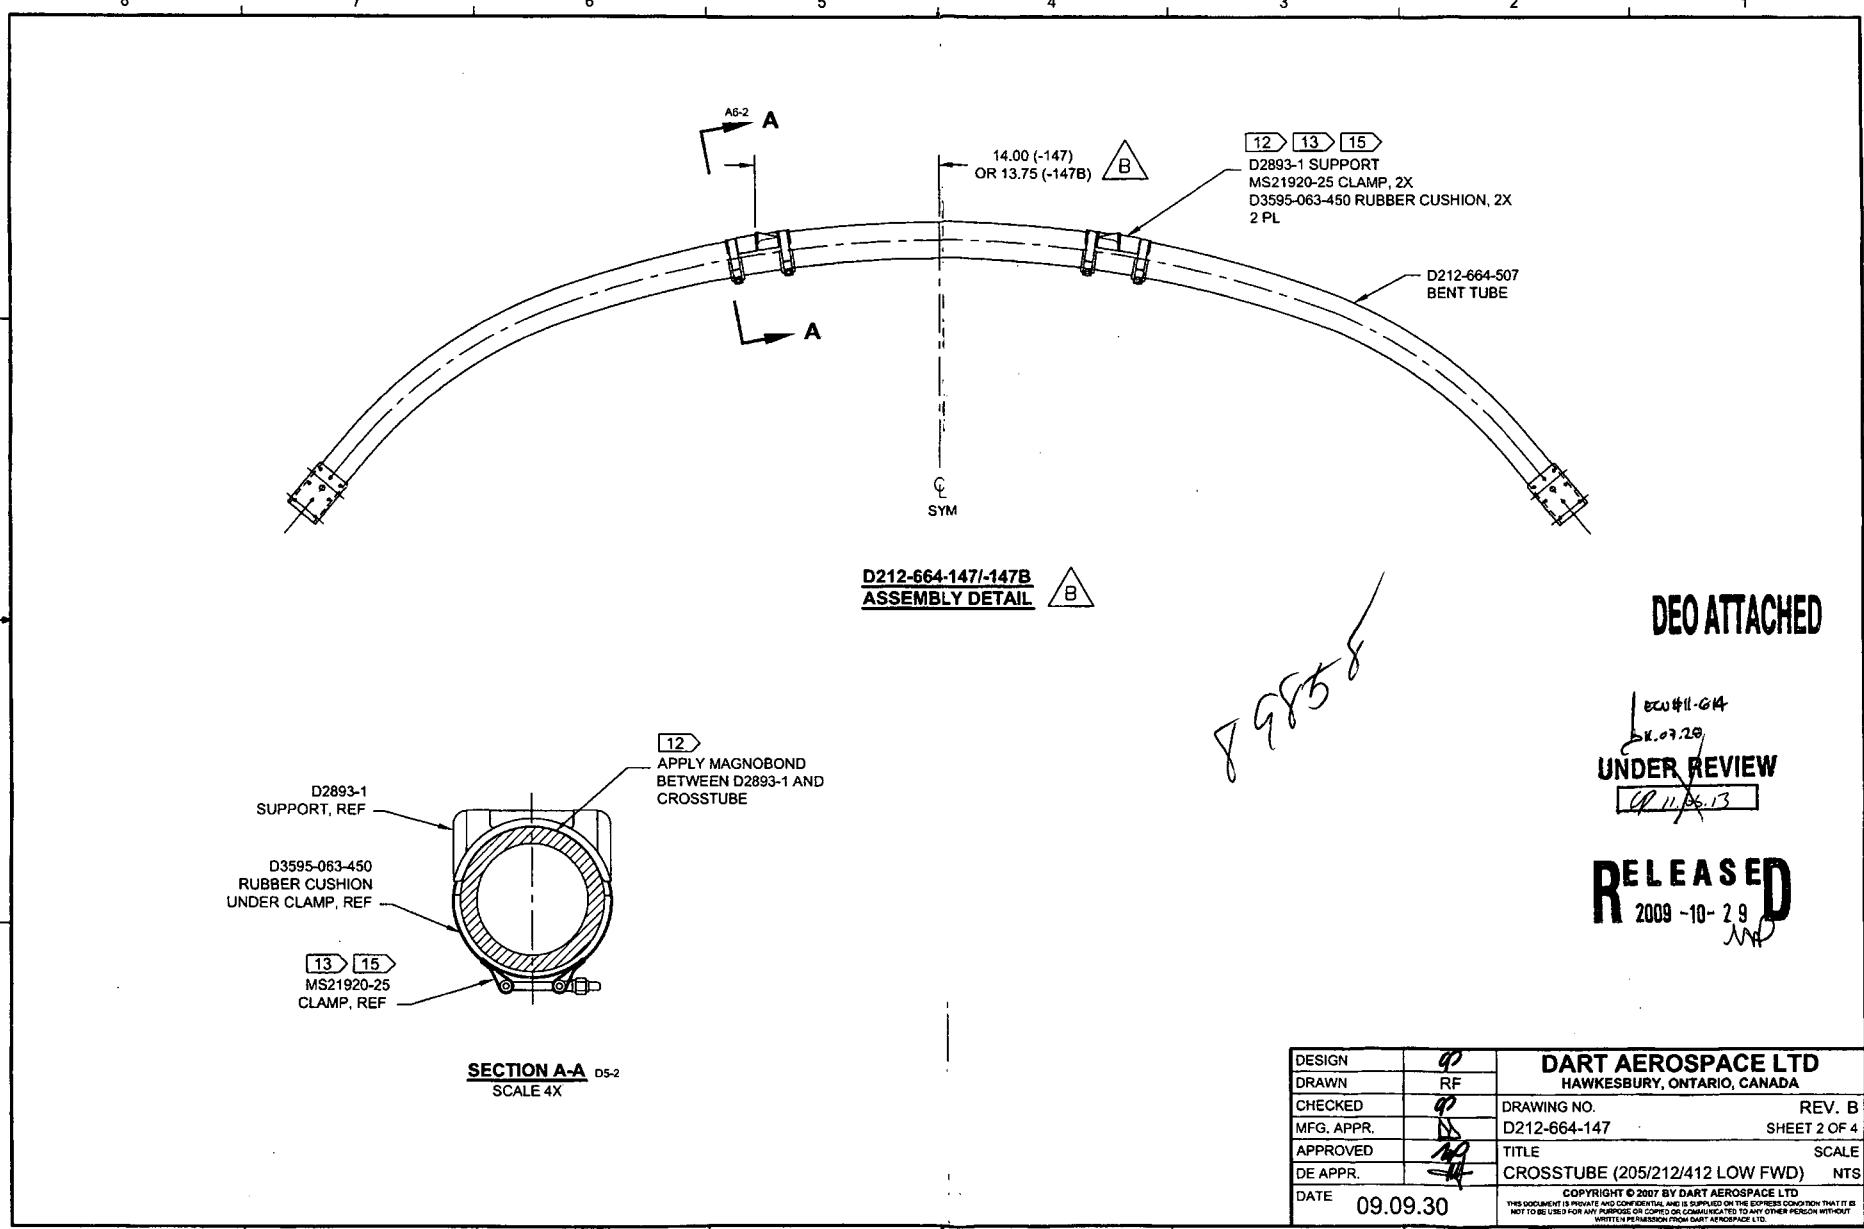

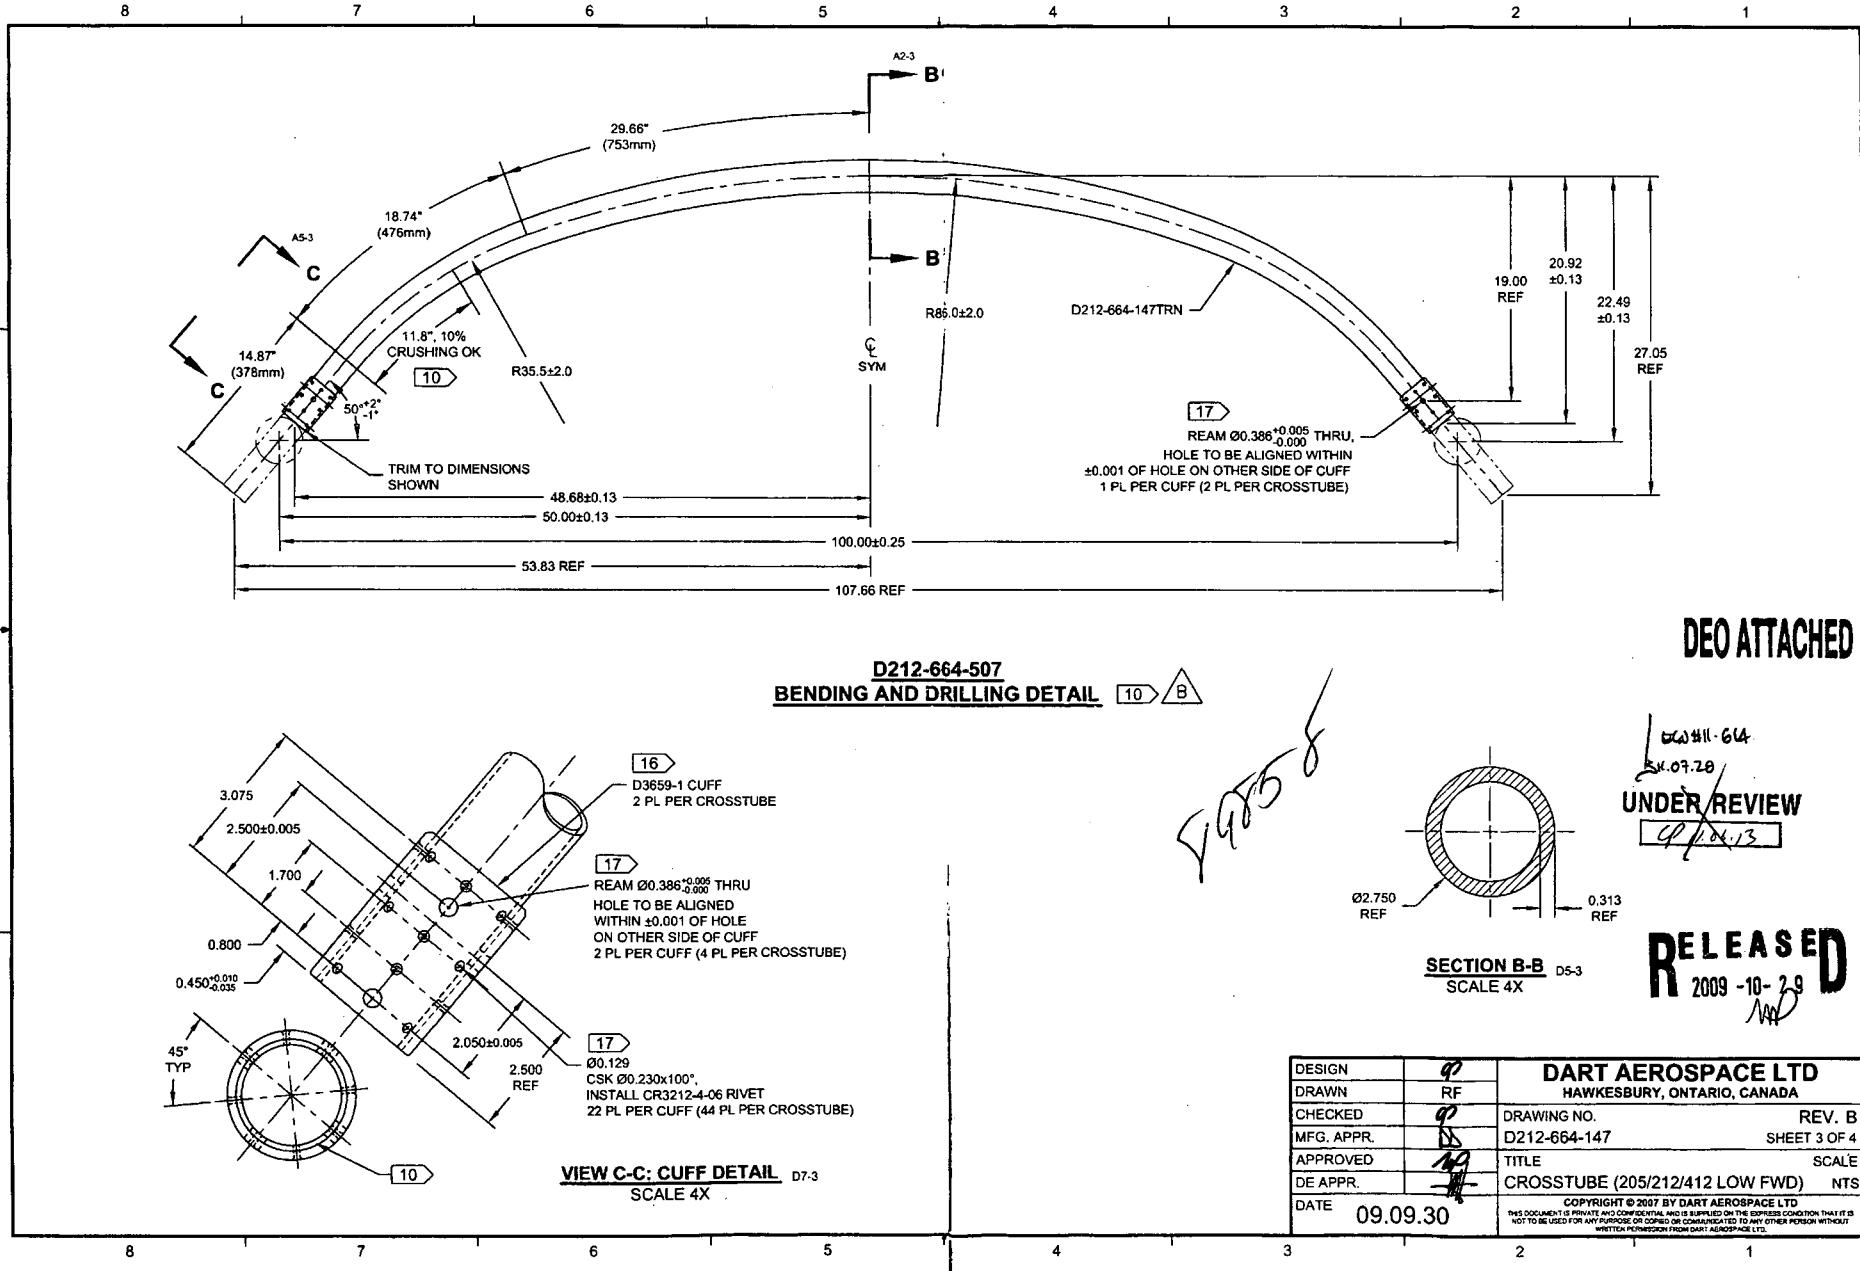


8 7 6 5 4 3 2 1

D

D

C

C

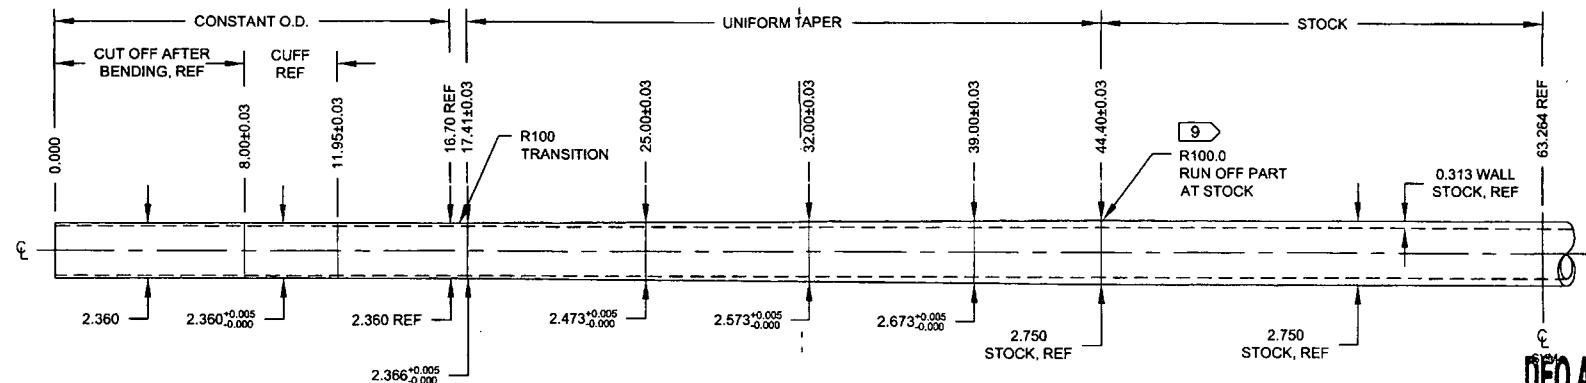

D212-664-147TRN
TURNING DETAIL

DEO ATTACHED

ECO #1-614
11.07.26
11/07/08
UNDER REVIEW
01/06/13

RELEASED
2009-10-29
AB

DESIGN	<i>RP</i>	DART AEROSPACE LTD	
DRAWN	<i>RF</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>RP</i>	DRAWING NO.	
MFG. APPR.	<i>NA</i>	REV. B	
APPROVED	<i>RP</i>	D212-664-147	
DE APPR.	<i>RP</i>	SHEET 4 OF 4	
DATE	09.09.30	TITLE	SCALE
		CROSSTUBE (205/212/412 LOW FWD) NTS	
		COPYRIGHT © 2007 BY DART AEROSPACE LTD	
		THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS	
		NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT	
		WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DRAWING NO. D212-664-147	TITLE CROSSTUBE ASS'Y (205 LOW FWD)	REV. B	DART AEROSPACE LTD ENGINEERING ORDER	D.E.O. NO. D212-664-147-B-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>qp</i>	CHECKED <i>ADS</i>	MFG. APPR. <i>128</i>	APPROVED <i>MP</i>	DE APPR. <i>MP</i>		
DATE 11.07.15	DATE 11.07.20	DATE 11.07.21	DATE 11.07.21	DATE 11.07.21	DATE 11.07.21	DATE 11.07.21

PURPOSE:

REPLACE MAGNOBOND WITH PROSEAL.

CHANGE:

IS:

Item	Qty -147	Qty -147B	Part Number	Description
9	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

WAS:

9	A/R	A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)
---	-----	-----	----------------	---

NOTE 12 & 15, SHEET 1 IS AMENDED AS FOLLOWS:

IS:

12) TO INSTALL D2893-1 SUPPORT: ABRADE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.

15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

WAS:

12) INSTALL D2893-1 SUPPORT USING 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2893-1 THAT WILL BE IN CONTACT WITH THE CROSSTUBE PER QSI 015. LET CURE FOR 12 HOURS AFTER INSTALLATION AND PRIOR TO PACKAGING.

15) TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING.

Q9858

RELEASED
2011-07-28
MP